

Release Notes

EPOS Connect for Win & Mac

Date: 16-07-2026

Version: 8.6.O(Win), 8.6.O(MAC)

DSEA SDK version: 12.13.O(Win), 12.13.O(MAC)

New features:

- Support for new devices: IMPACT 1000 MS UC ANC WL
- Faster firmware updates for IMPACT 400 MS UC ANC device

Changes and bug fixes:

- System and security improvements.

Known Issues:

- EPOS Connect cannot be installed by double-clicking the MSI package.
(Workaround: open Command Prompt with administrator privileges and run `msiexec /i "PATH\filename.msi"`).
- If Call control functionality does not work for MiVoice softphone with latest version of EPOS Connect application, the machine must be restarted.
- EPOS Connect for Mac versions prior to 8.5.O require uninstallation before proceeding with the installation of the latest release.
- Installation of DSEASDK can cause older MyApps applications to be stopped during installation.

*For more information about headset and softphone compatibility, please visit <https://www.eposaudio.com/en/compatibility-guide>.

Software Release History

Date: 30-04-2026

Version: 8.5.O (Win), 8.5.O (MAC)

DSEASDK version: 12.12.O (Win), 12.12.O (MAC)

Changes and bug fixes:

- DSEA SDK log files to be restricted to a maximum size of 15 MB.
- Resolved the firmware upgrade issue for IMPACT 100 MS MONO when upgrading from version 7.52.64.O to other versions. Upgrading the firmware to version 7.52.75.O resolves this issue.
- Fixed an issue where the EPOS Connect UI did not launch from the taskbar when video devices were connected.
- Fixed UI distortion issues affecting the EPOS Connect main UI and floating menu.
- Fixed connectivity issues between EPOS Connect and DSEA SDK.
- Fixed the issue where call control did not work for the Innovaphone softphone and it was not listed under Default Softphone in EPOS Connect.
- EPOS Connect for Mac upgrades now run in the foreground, allowing users to install self-signed certificates during the upgrade.
- System and security improvements.

Known Issues:

- EPOS Connect cannot be installed by double-clicking the MSI package.
(Workaround: open Command Prompt with administrator privileges and run `msiexec /i "<PATH>\<filename>.msi"`).
- Cloud and local updates are not working for Presence device when connected through BT 800.
(Work Around: Device can be updated by connecting through cable.)
- If Call control functionality does not work for MiVoice softphone with latest version of EPOS Connect application, the machine has to be restarted.

Date: 12-02-2026

Version: 8.4.O (Win)

DSEASDK version: 12.11.O (Win)

Changes and bug fixes:

- Fixed the issue where, after the system resumed from sleep, the EPOS Connect application window incorrectly spanned both the laptop display and the external monitor instead of restoring to a single screen.

- Fixed the translation issue where the 'Bluetooth' feature was inaccurately localized in Japanese for EXPAND 30, 40, and 80 series devices.
- Fixed the issue with call control functionality not working for latest versions of Alcatel-Lucent IP Desktop, Swyxt, Telia Touchpoint and Zoom softphones.
- System and security improvements.

Known Issues:

- EPOS Connect cannot be installed by double-clicking the MSI package.
(Workaround: open Command Prompt with administrator privileges and run `msiexec /i "<PATH>\<filename>.msi"`).
- Cloud and local updates are not working for Presence device when connected through BT 800.
(Work Around: Device can be updated by connecting through cable.)
- If Call control functionality does not work for MiVoice softphone with latest version of EPOS Connect application, the machine has to be restarted.

Date: 18-12-2025

Version: 8.3.1 (Win), 8.3.1 (MAC)

DSEASDK version: 12.10.0.6586(Win), 12.10.0.6586(MAC)

New features:

- Support for new devices: IMPACT 500 series and IMPACT 400 MS UC ANC

Changes and bug fixes:

- Fixed the screen scaling issues in the EPOS Connect application for ultrawide and super ultrawide monitors.

Known Issues:

- Upon system resume from sleep state, the EPOS Connect application window renders across both the primary laptop display and the external monitor instead of restoring to a single screen.
(Work Around: Relaunch the EPOS Connect application or adjust the UI position across displays.)
- Cloud and local updates are not working for Presence device when connected through BT 800.
(Work Around: Device can be updated by connecting through cable.)
- If Call control functionality does not work for MiVoice softphone with latest version of EPOS Connect application, the machine has to be restarted.

Date: 18-09-2025

Version: 8.3.0 (Win), 8.3.0 (MAC)

New features:

- Support for Busylight feature for IMPACT 800/1000 series devices.
- Support for Usage mode feature for BTD 900c (Firmware 1.4 onwards).

Changes and bug fixes:

- Moved the Language selection option from the Help page to the general settings page.
- Optimized display of the EPOS Connect application for various screen resolutions.
- Added support to notify users when the device is preparing for a firmware update.
- Updated the contact email to support@eposaudio.com.
- Fixed the issue of MiVoice 2380 crashing after ending Microsoft Teams call.
- Fixed the issue of EPOS Connect/SDK crashing and interruptions in the speaker sound when using MyApps softphone.
- System and security improvements.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BTD 800. (Work Around: Device can be updated by connecting through cable.)
- If Call control functionality does not work for MiVoice softphone with latest version of EPOS Connect application, the machine has to be restarted.

Date: 26-06-2025

Version: 8.2.1 (Win)

Changes and bug fixes:

- UI 20 BL USB (Busylight) integration has been updated to be compatible with Microsoft Teams version 25094.310.3616.953 and later versions.
- Fixed the issue where EPOS Manager was not collecting call activity reports for Microsoft Teams calls.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BTD 800. (Work Around: Device can be updated by connecting through cable.)

Date: 15-05-2025

Version: 8.2.0 (Win), 8.2.0 (MAC)

New features:

- Support for new devices: IMPACT 100.
- Support for Battery Low Warning feature for ADAPT 200 series (Firmware 1.10 onwards) devices when the battery level drops to 20% or below.

Changes and bug fixes:

- Implemented an auto-save feature for settings, eliminating the need for the 'Save' button.
- Displayed additional information for ADAPT E1 in the 'Updates Overview' tab to update ADAPT E1 Charge Case for enhanced performance.
- Support for CEHS CI-O2.
- Removed the "Audio Limiter" feature for USB-ED CC 01 MS - AUL device.
- Fixed the issue where EPOS Connect for Win was blocked by Microsoft AppLocker.
- Fixed the issue where multiple IMPACT 800 Series headset was not showing up in EPOS Manager device list.
- System and security improvements.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BT-D 800.
(Work Around: Device can be updated by connecting through cable.)

Date: 25-02-2025

Version: 8.1.0 (Win), 8.1.0 (MAC)

New features:

- Support for new devices: ADAPT E1, ADAPT E1 Charge Case, BT-D 900c and ADAPT Presence.
- Support for Battery Low Warning feature for SDW series headsets when the battery level drops to 25% or below.
- Support for MAC OS 15.

Changes and bug fixes:

- System and security improvements.
- Fixed the issue of EPOS Connect for Win giving pop up error when logging off/shutting down the PC.

- Fixed the issue of 64-bit Zoom Workplace not being listed in EPOS Connect application among the list of available softphones.
- Fixed the issue with second incoming call getting dropped for ESTOS ProCall softphone.
- Fixed the issue with call control functionality not working for Netphone Client.
- Fixed the issue where EPOS Connect for Mac was preventing Mac OS from shutting down.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BT D 800.
- (Work Around: Device can be updated by connecting through cable.)

Release Date: 04-02-2025

Version: 8.0.1(Win)

New features:

- None.

Changes and bug fixes:

- Optimized the ADGroup deployments to support only direct group members and remove nested group support.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BT D 800.
(Work Around: Device can be updated by connecting through cable.)

Release Date: 07-11-2024

Version: 8.0.0(Win), 8.0.0(MAC)

New features:

- Support for "Button Status" feature for IMPACT 700 series (Firmware 1.4 onwards) and IMPACT 800 series (Firmware 1.5 onwards) devices.

Changes and bug fixes:

- **Enhanced Navigation:** Updated the navigation pattern to streamline and improve user navigation.
- **Modernized Design:** Refreshed colors and graphics to provide a more contemporary and visually appealing user experience.
- Security improvements.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BT 800.
(Work Around: Device can be updated by connecting through cable.)

Release Date: 04-09-2024

Version:7.9.0(Win), 7.9.0(MAC)

New features:

- Support for new devices: IMPACT 400 series and ADAPT 660 c.
- Support for "Auto Pause" feature for BT 800a, IMPACT 700 series and IMPACT 800 series devices.

Changes and bug fixes:

- Security improvements.
- If the "Install all updates" option is selected multiple times before the update initiates, the EPOS Connect application will not appear in the list of installed programs.
(Note: The "Install all updates" will remain disabled till the update is complete)
- Feature name for "Volume Limiter" has been changed to "Audio Limiter".

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BT 800.
(Work Around: Device can be updated by connecting through cable.)

Release Date: 01-07-2024

Version: 7.8.2 (Win), 7.8.2 (Mac)

New features:

- Support for Sidetone setting to be configurable by the tenant admin for SDW Series devices.
(Note: In previous versions, EPOS Connect application will become unresponsive if Sidetone is configured from tenant admin)
- Support for Product Ringtone feature for IMPACT 700 series and IMPACT 800 series devices.

Changes and bug fixes:

- Security improvements.
- If the EPOS Connect application exits by clicking the 'X' button in the top-right corner or by right-clicking and selecting 'Close', and then relaunched, it displays as a black screen.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BT 800.
- (Work Around: Device can be updated by connecting through cable.)
- If the "Install all updates" option is selected multiple times before the update initiates, the EPOS Connect application will not appear in the list of installed programs.

Note:

- For local DSEASDK MSI installation, the custom MSI parameter 'AUTOLAUNCH_ENABLED=0' should NOT be set.
- For remote deployments of DSEASDK MSI installation, the custom MSI parameter 'AUTOLAUNCH_ENABLED=0' should be set and then AutoLaunch.exe present in the application program files can be used to start the services in user context.

Release Date: 06-02-2024

Version: **7.8.1 (Mac)**

New features:

- Support for new devices: IMPACT 700 series and IMPACT 800 series.

Changes and bug fixes:

- Fixed issue in installation package for MAC, when downloaded from eposaudio.com.

Known Issues:

- Firmware update fails when bluetooth headset is paired with BT 800 or BT 800a and headset does not get connect back to the dongle.
(Work Around: Need to repair the device and can be updated by connecting through cable.)
- Cloud and local updates are not working for Presence device when connected through BT 800.
(Work Around: Device can be updated by connecting through cable.)

Release Date: 22-01-2024

Version: **7.8.0 (Win), 7.8.0 (Mac)**

New features:

- Support to show battery status IMPACT SDW headsets connect via IMPACT SDW D1.
- Support for "Volume limiter" feature for SC660 ANC USB.
- Support for IMPACT SDW 60 Headset to be updated from firmware version 1.6.73.

Changes and bug fixes:

- Security improvements
- Fixed the issue of USB ED CC O1 MS with firmware versions 15.05.4C.412 and 15.05.4D.413 not getting detected in EPOS Connect application.
- "Always Audio" feature removed for IMPACT SDW D1 as it is not supported by the dongle.
- Fixed the issue of PC is going to standby/lock screen when USB ED CC O1 MS is connected and kept idle.
- Fixed the issue of EPOS Manager Tenant preference not getting applied for "Motion Sensor" and "Auto Answer" features for the SDW 60 HS headset.

Known Issues:

- Firmware update fails when Bluetooth headset is paired with BTD 800 or BTD 800a and headset does not get connect back to the dongle.
(Work Around: Need to repair the device and can be updated by connecting through cable.)
- Cloud and local updates are not working for Presence device when connected through BTD 800.
(Work Around: Device can be updated by connecting through cable.)

Release Date: 05-10-2023

Version: **7.7.O.44457(Win), 7.7.O.44457(Mac)**

New features:

- Support for Multiple calls on Zoom.
- Support for new devices: IMPACT USB-ED CC O1 AUL and CEHS-CI O2 V2.

Changes and bug fixes:

- Security improvements
- HeadSetup Pro application is restricted for upgrade to EPOS Connect version 7.7.0 or higher.
- Fixed the issue of Server and DSEA SDK connection details not displaying and call control functionality not working in EPOS Connect when MAC are rebooted.

- Fixed the issue of DSTNY softphone (versions 5.9.1 and above) not listed under Default Softphone in EPOS Connect.

Known Issues:

- Firmware update fails when Bluetooth headset is paired with BTD 800 or BTD 800a and headset does not get connect back to the dongle.
(Work Around: Need to repair the device and can be updated by connecting through cable.)
- Cloud and local updates are not working for Presence device when connected through BTD 800.
(Work Around: Device can be updated by connecting through cable.)

Release Date: 07-07-2023

Version: **7.6.1.42114(Win)**, **7.6.1.42114(Mac)**

New features:

- N/A

Changes and bug fixes:

- Fixed the issue of devices not being detected in EPOS Connect when MAC 13 OS machines are rebooted.
- System and security improvements.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BTD 800.
(Work Around: Device can be updated by connecting through cable.)

Release Date: 01-06-2023

Version: **7.6.0.40680(Win)**, **7.6.0.40680(Mac)**

New features:

- Support for new IMPACT 1000 series.

Changes and bug fixes:

- Fixed the recovery mode issue of ADAPT 660 AMC.
- Fixed custom ringtone update issue of UI 20 BL USB (Busy Light).
- Fixed silent update issue for IMPACT SDW D1 dongle with firmware version v0067.

- Fixed the firmware update issue for IMPACT DW series from version 135, 145 and 147.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BT 800.
(Work Around: Device can be updated by connecting through cable.)
- For Mac OS 13 machine, EPOS Connect will not work after reboot the machine.

Work around is to restart the service, this will work till the next reboot. Steps are given below.

Open the terminal, then at the command prompt, first unload the running service

“ sudo launchctl unload /Library/LaunchDaemons/com.EPOS.EPOSConnect.plist “.

Second load the service by running this command:

“ sudo launchctl load -w /Library/LaunchDaemons/com.EPOS.EPOSConnect.plist “.

Release Date: 09-05-2023

Version: 7.5.0.39710 (Win), 7.5.0.39710 (Mac)

New features:

- Support for new IMPACT 5000 series.
- Support for new SDK 12.0 (call control unit)
- Support for new application languages: Simplified Chinese and Traditional Chinese.
- Support for Pan & Tilt for EXPAND Vision 1 and S6.

Changes and bug fixes:

- Improved experience to move application window.
- Changes via new SDK 12.0
 - o Support Auto mode for default softphone: Auto-set the first detected softphone as default softphone, when there is no user preference.
 - o Remove 'Default headset': Headset selection is handled directly from softphone.
 - o Mute notification controls of IMPACT 5000 series have been moved to Base Station setting page.
- Listen mode can be used when ADAPT 200/300/400/500 series are connected via BT 800.
- Usage mode of BT 800 series can be configured when connected to IMPACT SDW base station with firmware version 1.8.42 and above.
- Fixed the issue of battery information not being displayed for C50.
- System improvements.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BT 800. (Work Around: Device can be updated by connecting through cable.)
- Usage mode of BT 800 series can only be configured when connected to IMPACT SDW base station with firmware newer than 2.x.
- Custom ringtone update for UI 20 BL USB (Busy Light) is not working. User can choose between three ringtones available on the device.
- For Mac OS 13 machine, EPOS Connect will not work after reboot the machine.

Work around is to restart the service, this will work till the next reboot. Steps are given below.

Open the terminal, then at the command prompt, first unload the running service

“ sudo launchctl unload /Library/LaunchDaemons/com.EPOS.EPOSConnect.plist “.

Second load the service by running this command:

“ sudo launchctl load -w /Library/LaunchDaemons/com.EPOS.EPOSConnect.plist “.

Software Release History

Release Date: 30-03-2023

Version: **7.4.1.38952 (Win), 7.4.1.38952 (Mac)**

New features:

- N/A.

Changes and bug fixes:

- Fixed the issue with Avaya Workplace placing calls on hold.
- Fixed the firmware update issue for IMPACT SDW 5000 series from version 1.3.47.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BT 800. (Work Around: Device can be updated by connecting through cable.)
- Usage mode of BT 800 series can only be configured when connected to IMPACT SDW base station with firmware newer than 2.x.
- Custom ringtone update for UI 20 BL USB (Busy Light) is not working. User can choose between three ringtones available on the device.
- For Mac OS 13 machine, EPOS Connect will not work after reboot the machine.

Work around is to restart the service, this will work till the next reboot. Steps are given below.

Open the terminal, then at the command prompt, first unload the running service

```
" sudo launchctl unload /Library/LaunchDaemons/com.EPOS.EPOSConnect.plist "
```

Second load the service by running this command:

```
" sudo launchctl load -w /Library/LaunchDaemons/com.EPOS.EPOSConnect.plist "
```

Release Date: 30-01-2023

Version: **7.4.O.37648 (Win), 7.4.O.37648 (Mac)**

New features:

- Support for new devices: EXPAND Vision 1M.
- Support to show battery status for MB Pro series, ADAPT 600 series and SP 30/40 series.
Notice: ADAPT 200/300/400/500 series will be supported when the new firmware is available.

Changes and bug fixes:

- Fixed the wrong translations of the voice prompt language setting in Japanese for EXPAND 80.
- Fixed the issue that check for update is failed when username contains some special characters.
- SC 1x5, SC 130/160 and PC 8.2 supports recovery mode.
- Add Voice prompts and clear pairing list functions for IMPACT MB Pro 1/2 series.
- Add Room experience feature for IMPACT MB Pro 2 series.
- System improvements on CPU consumption and Memory usage.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BT 800.
(Work Around: Device can be updated by connecting through cable.)
- Usage mode of BT 800 series can only be configured when connected to IMPACT SDW base station with firmware newer than 2.x.
- Custom ringtone update for UI 20 BL USB (Busy Light) is not working. User can choose between three ringtones available on the device.
- For Mac OS 13 machine, EPOS Connect will not work after reboot the machine.

Work around is to restart the service, this will work till the next reboot. Steps are given below.

Open the terminal, then at the command prompt, first unload the running service

```
" sudo launchctl unload /Library/LaunchDaemons/com.EPOS.EPOSConnect.plist "
```

Second load the service by running this command:

```
" sudo launchctl load -w /Library/LaunchDaemons/com.EPOS.EPOSConnect.plist "
```

Release Date: 18-10-2022

Version: **7.3.2.35483 (Win), 7.3.2.35483 (Mac)**

New features:

- N/A.

Changes and bug fixes:

- Fixed call control issues for SwyxIT.
- Fixed call control issues and call activity data for MiVoice.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BT 800. (Work Around: Device can be updated by connecting through cable.)
- Usage mode of BT 800 series can only be configured when connected to IMPACT SDW base station with firmware newer than 2.x.
- Custom ringtone update for UI 20 BL USB (Busy Light) is not working. User can choose between three ringtones available on the device.
- Some long Non-English contents on Vision 1 setting page cannot be fully displayed.

Release Date: 12-09-2022

Version: **7.3.1.34512 (Win), 7.3.1.34512 (Mac)**

New features:

- Support for new devices: EXPAND Vision 1 and S6.

Changes and bug fixes:

- Fixed the UI issue that shows very small size when EPOS Connect is launched with 4K display.
- Fixed the firmware update issue for IMPACT SDW 5000 series US and JP variants from version 1.3.51.
- Fixed the issue for SwyxIT when updating from DSEASDK 10.4.1 or earlier versions.
- Updated UI 20 BL USB (Busy Light) integration to be compatible with the latest version of Microsoft Teams 1.5.00.17656 and higher versions.
- In DSEASDK, fixed an issue during install/uninstall by using shell script instead of command prompt.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BT-D 800.
(Work Around: Device can be updated by connecting through cable.)
- Usage mode of BT-D 800 series can only be configured when connected to IMPACT SDW base station with firmware newer than 2.x.
- Custom ringtone update for UI 20 BL USB (Busy Light) is not working. User can choose between three ringtones available on the device.
- Some long Non-English contents on Vision 1 setting page cannot be fully displayed.

Release Date: 07-07-2022

Version: 7.3.O.32229 (Win), 7.3.O.32229 (Mac)

New features:

- Support for MAC OS 12.
- Support for new devices: COMMAND 260 USB PTT and ATC-C3 HS.

Changes and bug fixes:

- Fixed the issue that sidetone value in EPOS Connect does not match when the sidetone is changed from Windows PC.
- Enable Call control functions for Swxyit on Expand 40 series.

Known Issues:

- Cloud and local updates are not working for Presence device when connected through BT-D 800.
(Work Around: Device can be updated by connecting through cable.)
- Usage mode of BT-D 800 series can only be configured when connected to IMPACT SDW base station with firmware newer than 2.x.
- Custom ringtone update for UI 20 BL USB (Busy Light) is not working. User can choose between three ringtones available on the device.

Release Date: 16-05-2022

Version: 7.2.O.29083 (Win), 7.2.O.29083 (Mac)

New features:

- Support for new devices - ADAPT 660 AMC, EXPAND 40 Series, C10, C20, C50.
- Support for Call control functionalities for BroadSoft on MAC.

Changes and bug fixes:

- Support for 1 hour auto power-off settings for ADAPT 200/300/400/500 Series devices.
- Fixed the grey EPOS Connect screen issue for non-admin users.
- Fixed the device reset issue during Voice Prompt language change.
- When BT-D 800 (dongle) is in 'share mode', Connected Bluetooth headset requires manual repairing with dongle after Over-the-air (OTA) firmware update.

Known Issues:

- EPOS Connect "Desktop shortcut" is getting created even if the "Create Desktop shortcut" option is not selected in the EPOS Manager screen.
- Sidetone value in EPOS Connect does not match when the sidetone is changed from Windows PC. (Work Around: The Sidetone value can be changed from the EPOS Connect UI.)
- Cloud and local updates are not working for Presence device when connected through BT-D 800. (Work Around: Device can be updated by connecting through cable.)
- Custom ringtone update for UI 20 BL USB (Busy Light) is not working. User can choose between three ringtones available on the device.

Release Date: 24-01-2022

Version: 7.1.O.24484 (Win), 7.1.O.24112 (Mac)

New features:

- New UI for EPOS Connect Windows application.
- Support new softphone for Mac – Zoom.
- Support configurable Auto power off function for IMPACT 5000 series headset (only when it is undocked) and ADAPT 200,300,400,500 series.
- Support more mute notification types of IMPACT 5000 series: Visual (pop-up), Visual+Audible, off.
- Support mute notification interval of IMPACT 5000 series: when I start to speak, 1 min, 5 min, 10 min.

Changes and bug fixes:

- Usage mode of BT-D800 is supported when connected with IMPACT 5000 base station.
- Device detection and call control issues seen on non-English machines with EPOS Connect 7.1.O.24112.

Known Issues:

- The preferred language of the application is not retained when software upgrades are done from versions less than 7.1.O to versions 7.1.O or higher.

(Work Around: The user has to select the preferred language after software update.)

- Sidetone setting for IMPACT 5000 series headsets may not be presented in the application's device setting list on some of machines where device detection takes time.

Work Around: The sidetone can be changed using windows sound settings.)

- Update for IMPACT 5000 series devices will fail, when updating IMPACT 5000 base station and BTD 800 (only when connected with base station) on the same time.

(Work Around: User just need to click the update/retry again, firmware update will work.)

Notice: Firmware Silent update mode will not be impacted.

- To change 'HID Commands' setting for IMPACT 5000 series devices will need manual reboot (power supply + USB connection) to activate the change immediately.
- Custom ringtone update for UI 20 BL USB (Busy Light) is not working. User can choose between three ringtones available on the device.

Release Date: 07-10-2021

Version: 7.O.O.19631 (Mac)

New features:

- Support Mac OS v11.x (Big Sur).
- Support EPOS Devices IMPACT 5000 series, IMPACT D series, IMPACT D1 USB, ADAPT Presence Series, EXPAND 80 Mic, UI 20 BL USB (busy light).

Notice: Legacy MB Pro, BTD 800 and MB660 are supported.

Changes and bug fixes:

- Support to configure mute notification type for IMPACT 5000 series and the interval to trigger the mute notification.

Known Issues:

- Tenant connection is possible disconnected when the proxy setting of enterprise network is disable. User needs to click 'Connect' in the home page of EPOS Connect application when proxy is enabled again.